




- 1 Excess paper
- 2 Tweezer on work surface
- 3 Contact with open fill port
- 4 Bare wrist
- 5 Mask low on nose
- 6 Goggles on forehead
- 7 Gown unzipped
- 8 Nonsterile supplies in aseptic area
- 9 Arm resting on equipment
- 10 Adjusting goggles
- 11 Hood out of gown
- 12 Second hood out of gown
- 13 Rip in uniform
- 14 Bare wrist

**Figure 16-2** Example of a training cartoon showing 14 aseptic practice errors.

Other responsibilities of management that have great impact on employees, especially those working in classified air environments, are listed in Table 16-8.

### FDA Audits

It must be clearly appreciated that employee training occurs not to satisfy FDA and other regulatory group expectations, but rather to ensure that safe and effective drug products are manufactured and tested properly. When FDA GMP inspections focus on personnel training, they basically question what kind of training is performed, how is it documented, how is

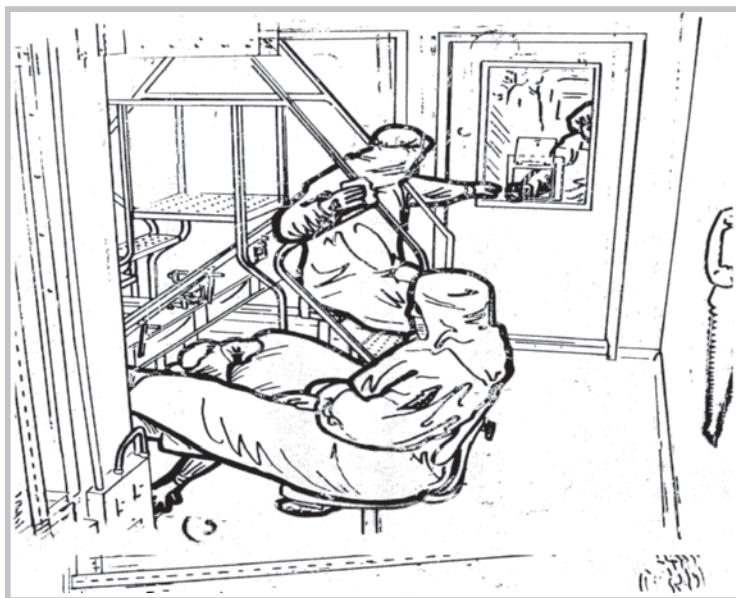

- 1 Transfer from less clean environment
- 2 Gloved hand about to touch non-sterile object
- 3 Goggles on head
- 4 Hood outside gown
- 5 Hand holding potential non-sterile item
- 6 Tear in glove
- 7 Sitting on ladder
- 8 Face mask below nose
- 9 Torn uniform
- 10 Hand touching lower body
- 11 Body posture shows poor attitude
- 12 Third hood outside gown
- 13 Picking up item on floor
- 14 Knee touching wall

**Figure 16-3** Another example of a training cartoon showing 14 aseptic practice errors.